



American Legend Aircraft Company  
1810 Piper Lane  
Sulphur Springs, Texas 75482  
903-885-7000

---

Service Bulletin: 070302 Rev A                      March 02, 2007 (Revised July 16, 2007 )

Subject: Throttle, Front to rear connect cable

Affected Models: AL3, AL-11 models, serial numbers AL-1005 to AL-1087 that are used for instruction or that are soloed from the rear seat.

Background: The wire cable that connects the rear to front throttle has broken on a small number of aircraft. Additionally the wire was bending or deforming and made the rear throttle hard if not impossible to operate. This never affected the front throttle to engine connection but could bind and cause difficulty in operating the front throttle.

American Legend developed a solid stainless steel rod to replace the cable connection. The replacement kit is part number 200-CN0107, Throttle Interconnect Upgrade.

Service Bulletin:

American Legend Aircraft Company suggest the replacement of the connection cable between the front and rear throttle quadrants for aircraft that are used for instruction are that are soloed from the rear seat. These parts should be replaced during the next annual inspection.

A kit containing this material can be ordered from American Legend Aircraft Company. Kit part number is 200-CN 0107, Throttle Interconnect Upgrade.

Aircraft logbook should be annotated showing compliance with this suggested Service Bulletin.